

# FIAT SERVICE LETTER


SUBJECT: CORRECTION TO X1/9 SHOP MANUAL, PART NO. 8061

VEHICLE: X1/9 MODEL

CORRECTION: The illustration pertaining to the crankshaft on page 40, Crankcase Section of the Shop Manual is incorrect.

In the illustration, the center and rear main bearing caps should be switched. The center cap does not have a lubrication groove whereas the rear cap is grooved. The illustration below has been revised to show correct bearing locations.

The illustration will be corrected in the next printing of the Shop Manual.

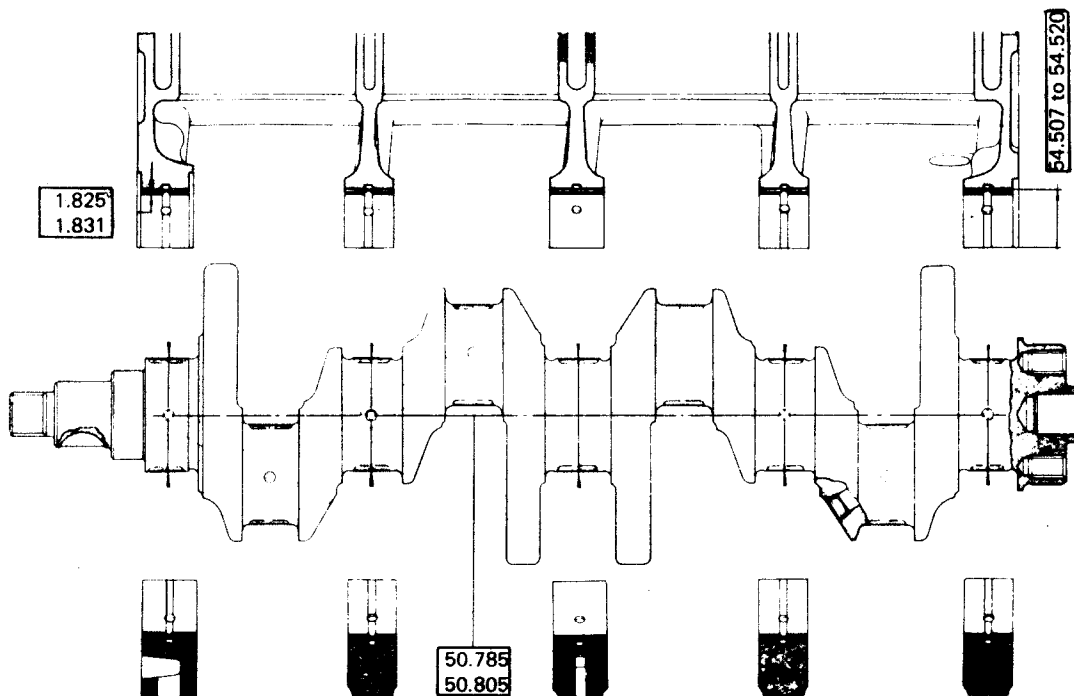

READ, INITIAL AND PASS ON

Service Manager	Parts Manager	Service Writer	Technician			